

Junos Space Network Director Release 3.3R1 Release Notes

27 June, 2018

Contents

Introduction	2
Release Notes for Junos Space Network Director	2
Supported Platforms	2
Junos Space Network Management Platform Requirements	7
Junos Space DMI Schema Requirements for Network Director	7
Installation and Upgrade Instructions	10
Operational Notes on General Interface Use	10
Operational Notes on Device Discovery and Management	11
New and Changed Features for Network Director Release 3.3R1	12
Known Behavior	13
Known Issues	16
Resolved Issues	32
Documentation Updates	32
Third-Party Integration	33
Finding More Information	33
Documentation Feedback	34
Requesting Technical Support	34
Self-Help Online Tools and Resources	35
Creating a Service Request with JTAC	35
Revision History	35

Introduction

Junos Space Network Director enables unified management of QFX Series switches, QFX Series switches with ELS, Datacenter Fabrics, EX Series Ethernet Switches, Junos Fusion Enterprise and Data Center Fabrics, EX Series switches with ELS, MX Series routers with ELS, Juniper Networks WLC Series Wireless LAN Controllers (WLCs), and VMware vCenter devices in your network. It provides for full network life cycle management by simplifying the discovery, configuration, visualization, monitoring, and administration of large networks containing physical and virtual devices. You can download the software images for Network Director, Junos Space Management Platform, management packs, and the release notes for Network Director Release 3.3R1 by using the appropriate links on the [Junos Space—Software Download](#) page.

Release Notes for Junos Space Network Director

These release notes accompany Network Director Release 3.3R1:

- [Supported Platforms on page 2](#)
- [Junos Space Network Management Platform Requirements on page 7](#)
- [Junos Space DMI Schema Requirements for Network Director on page 7](#)
- [Installation and Upgrade Instructions on page 10](#)
- [Operational Notes on General Interface Use on page 10](#)
- [Operational Notes on Device Discovery and Management on page 11](#)
- [New and Changed Features for Network Director Release 3.3R1 on page 12](#)
- [Known Behavior on page 13](#)
- [Known Issues on page 16](#)
- [Resolved Issues on page 32](#)
- [Documentation Updates on page 32](#)
- [Third-Party Integration on page 33](#)

Supported Platforms

[Table 1 on page 2](#) lists the supported platforms for Network Director Release 3.3R1 and the corresponding qualified Junos OS releases, Mobility System Software (MSS) releases, or VMware ESXi releases.

Table 1: Supported Platforms and Software Versions for Network Director

Supported Platforms	Qualified Junos OS, MSS, ESXi Releases, or Device Firmware Version
QFX Series Switches and Datacenter Fabrics	
QFX10008	Junos OS Releases 15.1X53-D30.19, 15.1X53-D33, 15.1X53-D60.4, 15.1X53-D61.7, and 15.1X53-D64.3

Table 1: Supported Platforms and Software Versions for Network Director (continued)

Supported Platforms	Qualified Junos OS, MSS, ESXi Releases, or Device Firmware Version
QFX10002-36Q switches with the following SKU: QFX10002-36Q-DC QFX10002-72Q switches with the following SKU: QFX10002-72Q-DC	Junos OS Release 15.1X53-D61, 15.1X53-D61.7, 15.1X53-D64.3, and 17.2R1.13
QFX5200 switches with the following product SKUs: QFX5200-48Y	Junos OS Release 18.1R1
QFX5200-32C switches with the following SKUs: QFX5200-32C-AFI QFX5200-32C-AFO QFX5200-32C-DC-AFI QFX5200-32C-DC-AFO	Junos OS Release 15.1X53-D30.5 and 15.1X53-D230.3
QFX5210 switches with the following product SKUs: QFX5210-64C	Junos OS Release 18.1R1
QFX5100 switches with the following product SKUs: QFX5100-48S-3AFI QFX5100-24Q-3AFI QFX5100-24Q-3AFO QFX5100-24Q-D-3AFI QFX5100-24Q-D-3AFO QFX5100-48T-AFI QFX5100-48T-AFO QFX5100-48T-DC-AFI QFX5100-48T-DC-AFO	Junos OS Release 14.1X53-D35.3, 14.1X53-D40.8, and 14.1X53-D42.3
QFX5110 switches with the following product SKUs: QFX5110-32Q QFX5110-48S	Junos OS Release 17.2R2.8, 17.3R1.10, and 17.4R1.16
QFX10002 as Layer 3 Fabric spine device QFX10002-36Q as Layer 3 Fabric leaf device QFX10002-72Q as Layer 3 Fabric leaf device QFX5100 as Layer 3 Fabric spine or leaf device QFX5110-32Q as Layer 3 Fabric spine or leaf device QFX5110-48S as Layer 3 Fabric leaf device EX4300 as Layer 3 Fabric leaf device	Junos OS Release 15.1X53-D60, 15.1X53-D61.7, 15.1X53-D64.3, and 17.2R1.13 for QFX10002 Junos OS Release 17.4R1.15 for QFX10002-36Q Junos OS Release 17.4R1.15 for QFX10002-72Q Junos OS Release 14.1X53-D35.3, 14.1X53-D40.8, and 14.1X53-D42.3 for QFX5100 Junos OS Release 17.2R2.8, 17.3R1.10, and 17.4R1.16 for QFX5110-32Q Junos OS Release 17.2R2.8, 17.3R1.10, and 17.4R1.16 for QFX5110-48S Junos OS Release 14.1X53-D27, 14.1X53-D40.8, and 14.1X53-D42.3 for EX4300

Table 1: Supported Platforms and Software Versions for Network Director (continued)

Supported Platforms	Qualified Junos OS, MSS, ESXi Releases, or Device Firmware Version
QFX10002 as Layer 3 Fabric spine device (in an EVPN-VXLAN configuration) QFX5100 as Layer 3 Fabric leaf device (in an EVPN-VXLAN configuration) QFX5110 as Layer 3 Fabric leaf device (in an EVPN-VXLAN configuration) QFX5200-32C-32Q as Layer 3 Fabric spine or leaf device (in an EVPN-VXLAN configuration) EX4300 as Layer 3 Fabric leaf device (in an EVPN-VXLAN configuration)	Junos OS Release 15.1X53-D60, 15.1X53-D61.7, 15.1X53-D64.3, and 17.2R1.13 for QFX10002 Junos OS Release 14.1X53-D35.3, 14.1X53-D40.8, and 14.1X53-D42.3 for QFX5100 Junos OS Release 17.2R2.8, 17.3R1.10, and 17.4R1.16 for QFX5110 Junos OS Release 15.1X53-D210 for QFX5200-32C-32Q Junos OS Release 14.1X53-D27 for EX4300
QFX3500 (non-ELS) QFX3600 (non-ELS)	Junos OS Releases 12.3X50-D35 and 12.3X50-D40
QFX3500 with ELS (standalone and Virtual Chassis) QFX3600 with ELS (standalone and Virtual Chassis) QFX5100-48S with ELS (standalone and Virtual Chassis) QFX5100-24Q with ELS (standalone and Virtual Chassis) QFX5100-96S with ELS (standalone and Virtual Chassis)	Junos OS Releases 13.2X51-D30, 14.1X53-D15, 14.1X53-D27, 14.1X53-D40, and 14.1X53-D40.8
Virtual Chassis Fabric	Junos OS Release 13.2X51-D20, 14.1X53-D15, 14.1X53-D27, 14.1X53-D40
Virtual Chassis Fabric (QFX5110)	Junos OS Release 17.2R2.8, 17.3R2.10, and 17.4R1.16
QFabric systems (QFX3000-G and QFX3000-M)	Junos OS Releases 14.1X53-D15, 14.1X53-D17, and 13.2X52-D20
EX Series Switches	
EX2200 and EX2200-C (standalone and Virtual Chassis) and EX3200 EX3300 (standalone and Virtual Chassis) EX4200 (standalone and Virtual Chassis) EX4500 (standalone and Virtual Chassis) EX4550 (standalone and Virtual Chassis) Mixed EX4200, EX4500, and EX4550 Virtual Chassis EX6200 EX8200 (standalone and Virtual Chassis)	Junos OS Releases 12.2, 12.3, 13.2X50-D10, 13.2X50-D15, 13.2X51-D15, 13.2X51-D20, 13.2X51-D30, 14.1X53-D15, 14.1X53-D25, 15.1R1, 14.1X53-D40.8, 14.1X53-D35, and 14.1X53-D42.3 (For all the EX Series switches)
EX Series Switches with ELS	
EX2300 and EX3400	Junos OS Release 15.1X53-D50, 15.1X53-D51, 15.1X53-D52, 15.1X53-D55.5, and 15.1X53-D56
EX2300-48T EX2300-48P	Junos OS Release 15.1X53-D55
EX2300-24MP (Standalone and Virtual Chassis) EX2300-48MP (Standalone and Virtual Chassis)	Junos OS Release 18.1R1

Table 1: Supported Platforms and Software Versions for Network Director (continued)

Supported Platforms	Qualified Junos OS, MSS, ESXi Releases, or Device Firmware Version
EX3400-24P EX3400-24T EX3400-48P EX3400-48T	Junos OS Release 15.1X53-D55 and 15.1X53-D56
EX4600 (standalone and Virtual Chassis)	Junos OS Releases 13.2X51-D25, 14.1X53-D10, 14.1X53-D16, 14.1X53-D25, 14.1X53-D27, 14.1X53-D35, 14.1X53-D40.8, and 14.1X53-D42
EX4300 (standalone)	Junos OS Release 13.2X51-D15, 13.2X51-D20, 13.2X51-D30, 14.1X53-D27, 14.1X53-D40.8 and 14.1X53-D42.3
EX4300 Virtual Chassis	Junos OS Release 13.2X51-D15, 13.2X51-D20, 13.2X51-D30, 14.1X53-D27, 14.1X53-D40.8 and 14.1X53-D42.3 NOTE: The master switch in EX4300 Virtual Chassis must be running Junos OS Release 13.2X51-D20 or later for auto Virtual Chassis Resync to work. If this is not the case, the role changes and the addition or deletion of members will not reflect in Network Director.
Mixed EX4600 and EX4300 Virtual Chassis	Junos OS Releases 14.1X53-D25 and 14.1X53-D35.3 (For all the EX Series switches)
EX9200 (standalone and Virtual Chassis)	Junos OS Releases 16.1R1, 17.1R1.8, 17.2R1.13, 17.4R1.16, 18.1R1.9, and 18.2R1
EX9251 (Standalone and Virtual Chassis)	Junos OS Release 18.1R1
EX9253 (Standalone and Virtual Chassis)	Junos OS Release 18.2R1
MX Series Routers	
MX 240, 480, 960 (ELS)	Junos OS Release 13.2R2.4, 14.1R4, 14.2R2, and 15.1R1
MX 80, 104, 240, 480, 960, 2010, and 2020 (non-ELS)	Junos OS Release 14.1R4 and 15.1R1
Cloud Analytics Engine	
CentOS	CentOS Release 6.6
Ubuntu	Ubuntu Release 14.04
Cloud Infrastructure Providers	
VMware vCenter Server VMware Host	VMware ESXi versions 5.0, 5.1, 5.5, 6.0, and 6.5.

Table 1: Supported Platforms and Software Versions for Network Director (continued)

Supported Platforms	Qualified Junos OS, MSS, ESXi Releases, or Device Firmware Version
OpenStack	Supported Releases—Kilo Liberty, Mitaka, and Newton Ensure that the APIs listed in Table 2 on page 7 are running.
VMware NSX	Versions 4.1, 6.1, and 6.2
NSX-V	Version 6.1 and 6.2
Juniper Networks Management Pack	
VMware vRealize Operations (vROps) Management Pack Release 1.1	VROps Versions 6.0, 6.0.1, and 6.1
VMware vRealize Operations (vROps) Management Pack Release 2.0	VROps Versions 6.2, 6.3, 6.4, and 6.5
DHCP and File Server (FTP and TFTP)	
CentOS	CentOS Release 6.6
Ubuntu	Ubuntu Release 14.04
WLC Series Wireless LAN Controllers	
WLC8 WLC800 WLC880 WLC2800 WLC200	MSS Releases 7.7, 8.0, 9.0, 9.1, and 9.6.3.2
WLC2	MSS Releases 7.7 and 8.0
JunosV Wireless LAN Controller WLC100	MSS Releases 9.0, 9.1, and 9.6.3.2
WLA Series Wireless LAN Access Points	
WLA321 WLA322 WLA422 WLA432 WLA522 WLA532 WLA620 WLA622 WLA632	MSS Releases 7.7, 8.0, 9.0, 9.1, and 9.6.3.2
Aruba Devices Running Aruba Airwave	
Aruba Airwave	Version 8.0.7

Table 1: Supported Platforms and Software Versions for Network Director (continued)

Supported Platforms	Qualified Junos OS, MSS, ESXi Releases, or Device Firmware Version
Samsung Devices	
Samsung Access Points	Version 3.1.8.T2

Table 2: API Requirements for OpenStack

Name of the API	OpenStack Based Data center	OpenStack + NSX Based data center
Keystone API v2	Yes	Yes
Nova API v2	Yes	Yes
Neutron API v2	No	Yes
Ceilometer API v2	Yes, if you want to run the VM stats monitoring feature	Yes, if you want to run the VM stats monitoring feature

Junos Space Network Management Platform Requirements

Network Director Release 3.3R1 is supported on the Junos Space Network Management Platform Release 18.2R1. You must download this release of Network Director and Junos Space Network Management Platform from [Junos Space Network Management Platform - Download Software](#) page.

Network Director is supported on a Junos Space JA2500 appliance or a Junos Space Virtual Appliance that meets the hardware requirements specified in the Junos Space documentation. Network Director is not supported on a Junos Space instance running on a Juniper Networks NSM3000 appliance.

Junos Space DMI Schema Requirements for Network Director

In most installations, Junos Space automatically matches the DMI schemas to device families. But there might be certain situations where your network uses a device for which Junos Space does not have the latest or supported schema available. In such instances, you must obtain and upload the requisite schema and set it as the default DMI schema for each device family. Set a default DMI schema for each device family to enable Junos Space to apply an appropriate schema to a device family.

If you cannot find the schema equivalent, use the latest schema from the main release or contact the Juniper Support. For example, for an EX4500 switch running Junos OS Release 13.2X51-D20, you must use the Junos OS Release 13.2X51-D20 schema. If this is not available, you can use the latest schema available from the Junos OS Release 13.2X51 releases. Use [Table 3 on page 8](#) as a guideline for the fallback schema that you can obtain and upload in Junos Space before you start working on Network Director Release 3.3R1.

Table 3 on page 8 lists the latest DMI schema that you must obtain and upload in Junos Space before you start working on Network Director Release 3.3R1.

Table 3: DMI Schemas

Device	Name of the DMI Schema	Device Family
QFX10008	JUNOS 15.1X53-D30.19 JUNOS 15.1X53-D32.2 JUNOS 15.1X53-D60.4 JUNOS 15.1X53-D61.7 JUNOS 15.1X53-D64.3	junos-qfx
QFX10002	JUNOS 15.1X53-D32.2 JUNOS 15.1X53-D60.4 JUNOS 15.1X53-D61.7 JUNOS 15.1X53-D64.3 JUNOS 17.2R1.13	junos-qfx
QFX5200	JUNOS 15.1X53-D30.19 JUNOS 15.1X53-D230.3	junos-qfx
QFX5200-32C-32Q	JUNOS 15.1X53-D210	junos-qfx
QFX5100-48S with ELS (standalone and Virtual Chassis) QFX5100-24Q with ELS (standalone and Virtual Chassis) QFX5100-96S with ELS (standalone and Virtual Chassis)	JUNOS 14.1X53-D35.3 JUNOS 14.1X53-D40.8 JUNOS 14.1X53-D42.3	junos-qfx
QFX5100 switches with the following product SKUs: QFX5100-48S-3AFI QFX5100-24Q-3AFI QFX5100-24Q-3AFO QFX5100-24Q-D-3AFI QFX5100-24Q-D-3AFO	JUNOS 14.1X53-D35.3 JUNOS 14.1X53-D40.8 JUNOS 14.1X53-D42.3	junos-qfx
QFX5100 switches with the following product SKUs: QFX5100-48T-AFI QFX5100-48T-AFO QFX5100-48T-DC-AFI QFX5100-48T-DC-AFO	JUNOS 14.1X53-D35.3 JUNOS 14.1X53-D40.8 JUNOS 14.1X53-D42.3	junos-qfx
QFX5110 switches with the following product SKUs: QFX5110-32Q QFX5110-48S	JUNOS 17.2R2.8 JUNOS 17.3R1.10 JUNOS 17.4R1.16	junos-qfx
QFabric devices	JUNOS 14.1X53-D15 JUNOS 14.1X53-D17	junos-qlf

Table 3: DMI Schemas (continued)

Device	Name of the DMI Schema	Device Family
QFX3500 (non-ELS) QFX3600 (non-ELS)	JUNOS 12.3X50-D35	junos-qfx
QFX3500 with ELS (standalone and Virtual Chassis) QFX3600 with ELS (standalone and Virtual Chassis)	JUNOS 14.1X53-D35.3 JUNOS 14.1X53-D40.8 JUNOS 14.1X53-D42.3	junos-qfx
EX4300	JUNOS 14.1X53-D35.3 JUNOS 14.1X53-D40.8 JUNOS 14.1X53-D42.3	junos
EX9200	JUNOS 16.1R1.11 JUNOS 17.1R1.8 JUNOS 17.2R1.13 JUNOS 17.4R1.16 JUNOS 18.1R1.9 JUNOS 18.2R1	junos
EX4600	JUNOS 14.1X53-D35.3 JUNOS 14.1X53-D40.8 JUNOS 14.1X53-D42.3	junos-qfx
EX2200 and EX2200-C (standalone and Virtual Chassis) and EX3200 EX3300 (standalone and Virtual Chassis) EX4200 (standalone and Virtual Chassis) EX4500 (standalone and Virtual Chassis) EX4550 (standalone and Virtual Chassis) Mixed EX4200, EX4500, and EX4550 Virtual Chassis EX6200 EX8200 (standalone and Virtual Chassis)	JUNOS 14.2X53-D35.3 JUNOS 14.1X53-D40.8 JUNOS 14.1X53-D42.3	junos-ex
EX2300	JUNOS 15.1X53-D55.5 JUNOS 15.1X53-D56	junos-ex
EX3400	JUNOS 15.1X53-D55.5 JUNOS 15.1X53-D56	junos-ex

Table 3: DMI Schemas (continued)

Device	Name of the DMI Schema	Device Family
MX Series Routers MX80 MX104 MX240 MX480 MX960 MX2010 MX2020 Series routers	JUNOS 15.1R1.9	junos

See [Setting a Default DMI Schema](#) for detailed steps for setting a default schema.

Installation and Upgrade Instructions

Before you begin to install Network Director Release 3.3R1, ensure the following:

- The Junos Space Network Management Platform is of the required release number with the latest patch installed. For more information about the software requirements for Junos Space Network Management Platform, see [“Junos Space Network Management Platform Requirements” on page 7](#).
- Network Director cannot be installed on a system that has Connectivity Services Director or Edge Services Director already installed. Uninstall Connectivity Services Director or Edge Services Director before you install Network Director on your system.

For instructions on installing and upgrading Network Director, see [Network Director Quick Start Guide](#).

Operational Notes on General Interface Use

- The recommended screen resolution is 1280 x 1024. If your screen resolution is less than the supported resolution, the Network Director UI might not be displayed properly. For example, icons might not be displayed on the Network Director banner, pages might appear truncated, or scroll bars might not work correctly.
- The supported Web browsers are Google Chrome version 17 and later, Mozilla Firefox version 14.0 and later, and Microsoft Internet Explorer versions 9.0, 10.0, and 11.0.
- Network Director does not support cold migration of virtual machines. Cold migration is the migration of a virtual machine that is powered off.
- You can log in directly to Network Director without logging in to the Network Management Platform first. To do so, use the URL:

```
https://<junos-space-host>/networkdirector
```

The default username and password is the administrator’s username and password.

- If you have logged in to Network Director for a long period of time, the connection to the server might time out. Monitoring screens might go blank or you might not be able to access tasks. To resolve this, log out of Network Director and then log in again.

- If you receive Java exception error message when you perform an operation, retry the operation. The error condition is usually temporary and has no other impact.
- In large-scale environments, it might take some time for the network tree in the View pane to reflect changes such as newly discovered devices or newly created locations.
- Deployment of configurations to QFX5100 switches from Network Director is possible only after you run the following commands by using the CLI of the QFX5100 switch:

```
[edit]
user@swi tch# set system extensions providers juniper license-type juniper deployment-scope
commercial
user@swi tch# set system extensions providers chef license-type juniper deployment-scope
commercial
```

Operational Notes on Device Discovery and Management

- The administrator username that you specify for discovering the OpenStack server must have admin privileges and must belong to an admin tenant in the OpenStack server.
- In a data center network, changes that you make to a vCenter network are dynamically updated in Network Director. However, changes that are made on an OpenStack network require you to wait for the periodic synchronization job to run or you must perform a manual resynchronization for the changes to be updated in Network Director.
- While discovering a CPE switch for a QFabric system, we recommend that you use the root user credentials.
- You must run the following command on all the switches that are connected to a vCenter server for LLDP discovery to work.

```
user@swi tch# set protocols lldp port-id-subtype interface-name
```

- For Network Director to be able to discover and manage devices, the following protocol ports must be open between the Junos Space Network Management Platform server and the devices:
 - Port 22 for SSH connections. If you have changed the SSH port to a port other than port 22 on your Network Management Platform, you must change the SSH ports on your managed devices to the port that the Network Management Platform uses.
 - Port 443 for virtualization and RingMaster import support. Use port 443 for outbound traffic to vCenter servers.



NOTE: If your RingMaster server uses any port other than port 443, then you must open that port from the Junos Space Network Management Platform server.

- Port 10162 for SNMP traps. Network Director receives traps from managed devices on this port. (After you install Network Director, use Network Director to configure SNMP on your devices to send traps to Network Director on this port.)

- Port 8889 for the management of wireless LAN controllers.
- Port 21 (TCP) and port 69 (UDP) for uploading the software image and configuration file to the FTP server.
- Port 8282 for connecting to the DLE.
- Ports 8774, 9696, 9292, 8777, 35357, and 8776 for accessing OpenStack and VMware NSX APIs.

You can verify that the ports are open to the devices by logging in to the Network Management Platform CLI and executing the **nmap** command. For example, to verify that port 8889 is open to a controller, enter:

```
root@space# nmap <controller-ip-address> -p 8889
```

- When the port statistics counters on a device are reset either manually or during an image upgrade, the traffic widgets might show incorrect values for some time. If this happens, wait for 2 to 3 poll intervals, after which the issue resolves itself.
- For wired devices, you might not be able to specify the SNMP community string from Network Director. However, the Refresh Discovery task from Topology View requires the SNMP community string to be configured on the device to proceed with the refresh discovery task. As a workaround, use the CLI to configure the required community string on the device before you use the Refresh Discovery task.

New and Changed Features for Network Director Release 3.3R1

- New hardware support—Starting in Release 3.3R1 and later, Junos Space Network Director supports discovering and provisioning of EX9253 devices.
- Support for port-based network access control monitoring—Starting in Release 3.3R1 and later, Network Director supports monitoring dot1x sessions on ports of satellite devices of a Junos Fusion Enterprise when dot1x authentication is configured on the ports.
- Enhanced support for Junos Fusion Enterprise—Starting in Release 3.3R1 and later, the following enhancements are made in Network Director for Junos Fusion Enterprise:
 - support for devices running Junos OS Release 18.1R1 and Release 18.2R1
 - support for EX9200-12QS, EX9200-40XS, EX9200-RE2, EX9200-40FM, and EX9200-MPC line cards
 - support for configuring EX9251 and EX9253 as aggregation devices
- Support for unassigning multiple port profiles—Starting in Network Director Release 3.3R1 and later, you can select multiple port profiles that are assigned to multiple interfaces and unassign them from the ports in a single step. For more information, see [Assigning and Unassigning a Port Profile from Interfaces](#).
- Support for monitoring PoE traps—Starting in Network Director Release 3.3R1 and later, you can monitor PoE traps on EX Series switches and satellite devices of Junos Fusion Enterprise.

The following changes enable monitoring of PoE traps:

- The **Set SNMP Trap Configuration** includes the category **PoE SMTP** to enable monitoring PoE traps.
- The Port Status - Physical table on the Dashboard view and the Port Status Detail (Physical) in the Monitor Mode Summary tab for an EX Series switch includes the **PoE** column to indicate whether a PoE trap is available or not for the ports on the switch.
- The Alarm Settings in Preferences includes the following two new alarms:
 - PoE Port ON-OFF Alarm—Enabled when the PoE power is turned on or off.
 - PoE Power Usage High—Enabled when PoE is above the defined threshold value.
- The **Show PoE Interfaces** option, is added to the Monitoring mode to view details, such as interface name, admin status, maximum power limit, power consumption and priority, in satellite devices of Junos Fusion Enterprise and EX Series devices. For more information, see [Viewing PoE Information](#).
- Support for configuring ESI-LAG—Starting in Network Director Release 3.3R1 and later, you can configure ESI-LAG between core and access devices in an EVPN-VxLAN topology by using Network Director. For more information, see [Creating and Managing ESI Link Aggregation Groups \(ESI-LAGs\)](#).

Known Behavior

This section lists the known behavior in Network Director:

- Network Director only supports SNMP V1 and V2C traps.
- When you install Network Director Release 3.2R1 on Junos Space Network Management Platform Release 17.2R1.4 with Security Director Release 17.2R1 already installed, Network Director is not listed in the drop-down list for selecting Junos Space applications and on the Applications page (**Network Management Platform > Administration > Applications**) though Network Director installation job is successful.

Workaround: You can use one of the following options to install Network Director Release 3.2R1 along with Security Director:



NOTE: If you are using Security Director Release 17.2R1 with Junos Space Platform Release 17.2R1.3, install the 17.2R1-hotpatch-v1 patch and restart JBoss on all Junos Space nodes and perform the listed options.

You can download the patch from

<https://webdownload.juniper.net/swdl/dl/secure/site/1/record/75246.html>.

- For a fresh or new installation of Junos Space Platform, Network Director and Security Director, use Junos Space Platform Release 17.2R1.4, Network Director Release 3.2R1, and Security Director Release 17.2R2.
- To install Network Director Release 3.2R1 on an existing installation of Junos Space Platform Release 17.2R1.4 and Security Director Release 17.2R1, upgrade Security Director to Release 17.2R2 and then install Network Director Release 3.2R1

- If you have already installed Network Director Release 3.2R1 on an existing installation of Junos Space Platform Release 17.2R1.4 and Security Director Release 17.2R1, perform the following steps:

1. Upgrade Security Director to Release 17.2R2.
2. Execute the following commands on the VIP node of the Junos Space fabric to deploy the **cm.ear** file.

```
/usr/local/jboss/bin/jboss-cli.sh --connect --controller=jmp-Cluster "deploy /usr/local/jboss/standalone/deployments/11/cm.ear --server-groups=platform"
```

- For EX4300 satellite devices to be part of a Junos Fusion Enterprise, ensure that you use *U-Boot 2011.12-00062-gf837a99 (Jul 11 2014 - 13:47:59)* and *FreeBSD/PowerPC U-Boot bootstrap loader 2.4* as the boot loader, with PoE firmware version 2.6.3.92.1, and *10G PIC-2 ports* as cluster ports.
- Juniper Networks Data Center Switching Management Pack for vROps does not display the following:
 - Layer 3 Fabric devices under Fabric option in the Juniper Infrastructure Overview Dashboard.
 - Data in the Health, Risk and Efficiency badges for Layer 3 Fabric devices.
- When defining your network configuration in quick templates by using a particular command, ensure that you define the subcommands individually. Stating subcommands as a single command causes errors. For example, the commands **set snmp location sunnyvale** and **set snmp contact admin@example.com** are valid when defined individually. However, if you combine these commands into the single command **set snmp location sunnyvale contact admin@example.com**, schema validation treats the last command **contact** as an extra entry and causes an error.
- In an OpenStack+NSX based data center, the flow analysis feature is not supported for virtual machines that are part of more than one network or VNI.
- Network Director does not support Junos Space domains and subdomains. Do not assign devices to domains and subdomains in Junos Space.
- EX4300 switch running Junos OS Release 14.1X53-D10 or 14.1X53-D15 cannot be managed using Network Director.
- If you are using Microsoft Internet Explorer version 9.0 or 10.0, the View Connectivity task in the Datacenter View and the Flow Analysis > View Details subtask in the Dashboard View might not work as expected. Use a supported version of Google Chrome or Mozilla Firefox to perform these tasks.
- EX4600 switches are grouped under Campus Switching ELS platform in Network Director even though the device family for EX4600 displays as JUNOS-QFX in the Inventory page. All Campus Switching ELS profiles can be associated with these switches.

You *must* use the QFX schema to manage this device instead of the EX ELS schema.

- In Location View, if you assign all the members of a Virtual Chassis, Virtual Chassis Fabric, or QFabric system to buildings or floors, then none of the Device level tasks are available. We recommend that you assign the entire logical device—the QFabric system, Virtual Chassis, or the Virtual Chassis Fabric—to any given location.
- For Data Center switching ELS Port profile, profile assignment might fail for single and multiple devices after you specify the port range of channelized interfaces even if the range you specified is within the range available on the device (or devices).
- When an EX4300 switch is used as a member switch in a QFX5100 mixed mode Virtual Chassis or Virtual Chassis Fabric, Network Director does not consider the configurations that you make on DCBX and Device Count fields, and configuration commits fail.
- If QFX3500, QFX3600, or EX4300 Virtual Chassis are running releases earlier than Junos OS Release 13.2X51-D20, any changes made to the Virtual Chassis, such as adding or deleting members or changing the role of members, might not reflect in Network Director.
- Deploying a Fabric profile that has the same name as an already deployed Fabric profile, but a different Fabric ID, removes the interface association of the first Fabric profile from the device. Therefore, do not deploy Fabric profiles with the same name on a device.
- With QFabric systems that are running Junos OS releases earlier than Release 13.1X50-D20, the Control Plane Topology does not work if the CPE switches are used in Virtual Chassis mode. If you need assistance with an earlier release, contact Juniper Networks support.
- Network Director does not support access points that are directly connected to a controller.
- Nonstop software upgrade (NSSU) for EX8200 Virtual Chassis might not work as expected.
- The Access profile configuration and the port security configuration that are part of the Port profile configuration might not work on EX9200 switches running Junos OS Release 12.3R2.5.
- Alarms generated on individual QFabric nodes do not display in Topology View. Bandwidth utilization value for VCP and aex interfaces might not be displayed in the Topology View.
- Network Director might not display:
 - Unprovisioned members added to a Virtual Chassis or a Virtual Chassis Fabric.
 - The *Not Present* status for members removed from a Virtual Chassis or a Virtual Chassis Fabric.
- For Data Center Switching ELS Port profile, a profile assignment might fail for channelized interfaces in a port range even when the channelized interfaces in that port range are available on the devices.
- The Validate Pending Configuration task does not validate the unsupported configurations on data center devices.

- In the manual mode, when out-of-band changes are resynchronized, the conflicting CR might not be listed for quick templates.
- In the Edit Layer 3 Fabric workflow, the deployment status might display as Failed for replaced or deleted QFX5100 or EX4300 switches (running Junos OS Release 13.2X51-Dnn) even if the configuration is successfully deployed on the device. Also, it might take more than 10 minutes for the device status to be updated in the Edit Layer 3 Fabric job.
- During a cluster switchover, if a backup configuration job or a device discovery job is running in Network Director, the switchover status might display as In progress even after the switchover is complete.
- In a Junos Fusion setup, you might need to assign two aggregation devices for an auto-profile policy. For example, if a satellite device has 65 ports, then you might need to add two aggregation devices as AD1: ge-65/0/1- ge-65/0/10 and AD2 : ge-65/0/1 - ge-65/0/10. To assign both the aggregation devices, select the aggregation devices at the group level and do not select the satellite device.
- When editing a MACsec profile that is already deployed in Network Director, you can modify all the configuration parameters in the MACsec profile, except the Connection Association Name and MACsec mode.
- The resynchronization job for the MX Series device fails if the VLAN ID for the device is configured as none from the device CLI.
- You cannot modify the configuration for a Layer 3 Fabric from Network Director if the Layer 3 Fabric was created using the brownfield process during device discovery in Network Director.

Known Issues

This section lists the known issues in Network Director Release 3.3R1.

For the most complete and latest information about known Junos Space Network Director defects, use the Juniper Networks online [Junos Problem Report Search](#) application.

- After deploying the ESI-LAG configuration on devices, an LACP configuration is created on the LAG interfaces of the client switch.

Workaround: Remove the LACP configuration by using the Quick Template option.

To remove the LACP configuration:

1. In the Build mode, on the Tasks pane, click **Wired > Manage Quick Templates**.

The Create Quick Template page appears.

2. On the Create Quick Templates page, enter values for configuring the quick template as follows:

- Name—Name for the quick template.
- Description—Description of the quick template.
- Device Family—Select the device family based on the client switch.
- OS Version—Select the OS version running on the client switch
- CLI Commands—Enter the following command:

```
delete interfaces Aggregated-interface-name aggregated-ether-options lacp
active
```

where, *Aggregated-interface-name* is the aggregated interface (ae) on the client switch on which the ESI-LAG is configured.

3. Click **Save** to save the quick template.

The Manage Quick Templates page appears.

4. On the Manage Quick Templates page, select the quick template and click **Apply** to deploy the quick template to all the client switches in the ESI-LAG.

The Apply Quick Template widget appears.

5. Follow the widget to deploy the quick template and delete the LACP configuration on the LAG ports of the client switches.

[PR 1369326]

- In the Junos Space GUI, Network Director Release 3.3R1 is not listed as one of the applications in the drop-down menu when you upgrade Network Director to Release 3.3R1 from Release 3.1R1 or Release 3.1R2.

Workaround: Restart JBoss.

To restart JBoss in a standalone Junos Space installation:

1. Log in to the console of the Junos Space node.
2. On the console, enter the debug shell mode.

3. Execute the following commands:

```
service jmp-watchdog stop
service jboss-dc stop
service jboss stop
service jmp-watchdog start
```

To restart JBoss in a Junos Space cluster installation:

1. Log in to the console of the backup JBoss node.
2. On the console, enter the debug shell mode.
3. Execute the following commands:

```
service jmp-watchdog stop
service jboss-dc stop
service jboss stop
```

4. Log in to the console of the primary JBoss node.
5. On the console, enter the debug shell mode.
6. Execute the following commands:

```
service jmp-watchdog stop
service jboss-dc stop
service jboss stop
service jmp-watchdog start
```

7. After the primary JBoss node is up, execute the following command on the backup JBoss node:

```
service jmp-watchdog start
```

[PR 1368620]

- When devices configured with ESI-LAG are resynchronized, a redundant ESI-LAG is created with the same logical number as the existing ESI-LAG.

Workaround: The redundant LAG does not cause any issues to the existing ESI-LAG and can be ignored.

The redundant ESI-LAG should not be deleted or modified until the existing ESI-LAG is present in Network Director. Once the LAG configuration is deleted, the redundant ESI-LAG should be manually deleted from Network Director.

[PR 1368675]

- Unable to revert changes when a deployed ESI-LAG is deleted and then the delete operation is discarded. [PR 1366966]
- When an LLDP connection exists between the peers and the peers and client on which ESI-LAG is configured, the port details do not autopopulate in the Peer To Peer Settings table and the Client To Peer Settings table. [PR 1363878]
- In the Pre-Deployment Edit workflow for an ESI-LAG configuration, the following issues are seen:
 - Unable to modify Virtual Switch Name in the routing instance.
 - In the Client to Peer table, unable to edit peer ports.

[PR 1368165]

- Network Director does not allow deleting an access profile when RADIUS and LDP are configured. Deleting the access profile results in an error. [PR 1365125]
- In a port profile, link mode settings should be filtered out for xe interfaces on EX9200 and QFX5100 devices as starting in Junos OS Release 17.1R1, xe interfaces do not support link mode. [PR 1357626]
- After you upgrade Network Director from Release 2.5 to Release 3.0, the VMware vRealize Operations (vROps) stops receiving data from Network Director.

Workaround: After upgrading to Network Director Release 3.0, open the vROps user interface and delete the ND adapter, add the ND adapter afresh, and try again.

[PR 1232254]

- If you open Network Director in multiple tabs of the same browser window, autorefresh works only for the latest tab.

Workaround: For autorefresh to work on all sessions, use different browsers. [PR978137]

- Network Director promotes duplicate VLAN profiles to VLAN with VRRP profiles when you make out-of-band changes to a device.

Workaround: Delete the unassigned profile from Network Director. [PR1120850]

- With Microsoft Internet Explorer 11, the View Virtual Network Connectivity page in the Datacenter View might not display the Zoom In, Zoom Out, and Refresh icons.

Workaround: Scroll to the left of the screen to use the Zoom In, Zoom Out, and Refresh icons. [PR1098365]

- When you create a Zero Touch Provisioning (ZTP) profile, you are unable to add a default route or gateway address.

Workaround:

1. Open the *dhcpd.conf* file on the DHCP server.
2. Add an entry for **option routers**, between the **subnet** and **option subnet-mask** entries of the appropriate subnet, and specify the gateway IP address as shown in the example below:

An example code snippet:

```
subnet 10.222.210.0 netmask 255.255.254.0{
option routers 10.222.210.1;
option subnet-mask 255.255.254.0;
```

3. Restart the dhcpd service from the Junos Space console by issuing the **service dhcpd restart** command.

[PR1103325]

- After you make out-of-band changes on authentication details that are part of a VRRP profile, refreshing the configuration does not create a new profile.

Workaround: Make the out-of-band changes as part of the VRRP profile, deploy the VRRP profile, and resynchronize the configuration from Network Director. [PR1100717]

- All the saved changes (not deployed) on the Manage IP connectivity page are lost after you add a new device to the data center.

Workaround: Before adding a new device to the data center, deploy all the changes that you made in the Manage IP Connectivity page. [PR1109046]

- After you deploy a policy from Network Director, if you clear the policy options and remove the corresponding Route Filters, only the association of the policy with BGP is deleted. The policy as such is not deleted from the device.

Workaround: None available at present. [PR1109827]

- If you have VRRP version 3, after you edit an already deployed Device Common Settings profile and deploy the changes, the deployment fails. This occurs because Network Director appends the VRRP version 3 configuration also to the changed configuration, whereas only the changed configuration must be deployed.

Workaround: Disable VRRP version 3 or make VRRP configuration compatible with version 3. [PR1118766]

- In the Manage IP Connectivity workflow, if you opted not to resynchronize devices that are Out of Sync, then all new Save or Deploy operations might fail with the following message Manage IP Connectivity Fails.

Workaround: Synchronize the devices once prompted. [PR1119978]

- Deleting configuration files in Junos Space for devices also removes the baseline for the devices.

Workaround: None available at present. [PR1107121]

- If an image upgrade job and a cluster fail job runs simultaneously, the image upgrade job status might show as Success, but the image might not have been upgraded.

Workaround: Retry the image upgrade after cluster failover is complete. [PR1109072]

- Device might continue to remain in the Synchronising state after some deployments.

Workaround: Initiate a manual resynchronization for the devices using the Resynchronize Device Configuration task. [PR1111410]

- During ZTP, device autodiscovery might fail if the device takes long time to reboot after upgrading to the new image.

Workaround: Discover the device manually if autodiscovery failed after ZTP. [PR1114186]

- Conversion of two standalone satellite devices to a three member cluster might fail causing the status of one member to be displayed as provision down.

Workaround: Execute the following command by using the CLI of the aggregation device: `run request chassis satellite reboot fpc-slot fpc-slot-number`. [PR1200371]

- The EX9200 device is not identified as an aggregation device in Junos Fusion setup and the link up job is not triggered.

Workaround: Configure SNMP on EX9200 devices to identify it as an aggregation device. [PR1186656]

- If two MC-LAG peer devices are brown fielded with different device models and if the IP address of any one of the MC-LAG devices matches the IP address of a Peer device of another MC-LAG device, then the Manage MC-LAG page might display MC-LAG pairing with a different model.

Workaround: Ensure that MC-LAG peer device has a unique ICCP local IP address in the network. [PR1116833]

- In the Dashboard View, the data for the last one hour is displayed in grey color after the filter criteria is applied for one hour.

Workaround: None available at present. [PR1058767]

- Network Director does not support IPv6 topology discovery.

Workaround: None available at present. [PR1204972]

- Network Director might not be able to discover virtual machine tags for vCenter Version 6.0, if there is no description for tags or categories.

Workaround: Upgrade to vCenter Version 6.0 Update 1 or later and try again. [PR1186865]

- Brownfield fails if both the `apply-groups` and the interface description CLI are present under the `interface-range` stanza. This type of configuration is mostly seen for QFabric CPE.

Workaround: Delete the **apply-groups** configuration under the **interface-range** stanza and specify the groups configuration directly under the **interface-range** stanza.

For example in the QFabric CPE configuration, do the following:

1. Delete the **apply-groups** configuration under the interface ranges **Node_Device_Interfaces** and **Interconnect_Device_Interfaces**:

```
user@device#delete interfaces interface-range Node_Device_Interfaces apply-groups
qfabric-int
user@device#delete interfaces interface-range Interconnect_Device_Interfaces apply-groups
qfabric-int
```

2. Specify the configuration under the groups `qfabric-int` directly within the **interface-range** stanza:

```
user@device#set interfaces interface-range Node_Device_Interfaces mtu 9216
```

```
user@device#set interfaces interface-range Node_Device_Interfaces unit 0 family
ethernet-switching port-mode access vlan members qfabric
user@device#set interfaces interface-range Interconnect_Device_Interfaces mtu 9216
user@device#set interfaces interface-range Interconnect_Device_Interfaces unit 0 family
ethernet-switching port-mode access vlan members qfabric
```

3. Commit the changes:

```
user@device#commit
```

```
[PR1125950]
```

- In the Datacenter Connectivity View, the zoom pane that appears at the bottom right might not highlight the area that is zoomed.

Workaround: None available at present. [PR1100350]

- If you physically connect a new Virtual Chassis leaf member before adding the leaf member from Network Director, the leaf member might not be mapped to Layer 3 Fabrics as expected.

Workaround: Plug and play is not supported for Virtual Chassis leaf members. Therefore, before you physically connect the Virtual Chassis members, make sure that you add the Virtual Chassis leaf members by using the Layer 3 Fabric wizard. [PR1098910]

- While editing Layer 3 Fabric profiles (Port, VLAN, and Device profiles) users are not warned by any notification that changing Layer 3 Fabric profile configurations might impact the Layer 3 Fabric functionality.

Workaround: After the profiles are modified, you can discard the changes from the Deploy task. [PR1058811]

- For Layer 3 Fabrics, if a plug-and-play leaf device is added and mapped to the Fabric, the Cabling page in the Edit Layer 3 Fabric workflow might not update the cabling plan for that leaf in the graph and grid views.

Workaround: When you edit the Layer 3 Fabric, modify the description in the Fabric Requirements page and then navigate to the Cabling page. The Cabling page updates the proper cabling plan for the plug-and-play leaf device. [PR1058827]

- In the manual mode, when out-of-band changes are resynchronized, the conflicting CR might not be listed for quick templates.

Workaround: None available at present. [PR1046833]

- In the Edit Layer 3 Fabric workflow, the deployment status might display as Failed for replaced or deleted QFX5100 or EX4300 switches (running Junos OS Release 13.2X51-Dxx) even if the configuration is successfully deployed on the device. Also, it might take more than 10 minutes for the device status to be updated in the Edit Layer 3 Fabric job.

Workaround: None available at present. [PR1061773]

- When you create the first data center in Network Director, the View pane might not be updated dynamically with the data center components and devices.

Workaround: Navigate to any other View and then return to the Datacenter View. [PR1061337]

- Discovery of a QFabric device that has some system log messages in the **default-log-messages** file might trigger multiple resynchronization jobs.

Workaround: Clear the system log messages in the **default-log-messages** file before discovery. The CLI command for clearing default log messages is **clear log default-log-messages**. [PR1027051]

- Network Director does not perform Virtual Chassis resynchronization for standalone devices when the device status changes from DOWN to UP or when Network Director restarts.

Workaround: Delete and rediscover the devices from Network Director. [PR1001626]

- In Topology View, Network Director does not display LAG details between QFabric and other devices.

Workaround: None available at present. [PR967224]

- For wired devices, you are unable to specify the SNMP community string from Network Director. However, the Refresh Discovery task from Topology View requires the SNMP community string to be configured on the device to proceed with the refresh discovery task.

Workaround: Use the CLI to configure the required community string on the device before you use the Refresh Discovery task. [PR1014926]

- If you associate a hierarchical Data Center switching or Campus switching ELS CoS profile that has Priority Flow Control configuration with an interface of an EX4300 switch that is part of an EX4600 Virtual Chassis, QFX Virtual Chassis, or Virtual Chassis Fabric, the deployment fails.

Workaround: Clone the CoS profile, remove the PFC settings from the cloned profile, and associate the cloned profile with the EX4300 interfaces. [PR1017364]

- When a device is removed from one Virtual Chassis or Virtual Chassis Fabric and added to another Virtual Chassis or Virtual Chassis Fabric respectively, the show virtual-chassis status output command from Network Director might not display the expected information for that member in either the Virtual Chassis or the Virtual Chassis Fabric.

Workaround: Before you discover that member from Network Director, recycle that member in the Virtual Chassis or Virtual Chassis Fabric in which the member device information is not displayed. [PR970798]

- If the IP address of space nodes change after installing Network Director, the Layer 3 Fabric configuration might still retain the old IP address of space nodes as the SNMP trap target.

Workaround: Log in to Junos Space console and select the (Debug) run shell option. Run the following commands at the shell prompt:

- `python2.7 /opt/configure_for_ND.py -ndvip <VIP> -nodeip <node management ip> -restport 20080 -traptgt <node management ip> -dbuser <DB user> -dbpass <DB password> -ndtrapport 10162`
- If there is a device management interface configured, run the same command using device management ip option as follows:
`python2.7 /opt/configure_for_ND.py -ndvip <VIP> -nodeip <device management ip> -restport 20080 -traptgt <device management ip> -dbuser <DB user> -dbpass <DB password> -ndtrapport 10162`
- If it is a cluster environment, the command needs to be run on each node. The argument `-traptgt` must be repeated the same number of times as the number of nodes present. Assuming there are four nodes, run the following command on each of the four nodes:
`python2.7 /opt/configure_for_ND.py -ndvip <VIP> -nodeip <node management ip> -restport 20080 -traptgt <node1 management ip> -traptgt <node2 management ip> -traptgt <node3 management ip> -traptgt <node4 management ip> -dbuser <DB user> -dbpass <DB password> -ndtrapport 10162`
- If it is a cluster environment and each node has a device management interface configured, the command needs to be run on each node. The argument `-traptgt` must be repeated the same number of times as the number of nodes present. Assuming there are four nodes, run the following command on each of the four nodes.
`python2.7 /opt/configure_for_ND.py -ndvip <VIP> -nodeip <device management ip> -restport 20080 -traptgt <node1 device management ip> -traptgt <node2 device management ip> -traptgt <node3 device management ip> -traptgt <node4 device management ip> -dbuser <DB user> -dbpass <DB password> -ndtrapport 10162`



NOTE: Junos Space Network Director discovers a virtual chassis device as a standalone device when the `openclos` service is not executing properly. Therefore, when you modify the IP address of a Junos space node, restart the `openclos` service after you execute the `/opt/configure_for_ND.py` script.

[PR1062066]

- Unable to close Details window under Monitor mode.
Workaround: Press **Esc** to close the Details window. [PR1117428]
- Monitor widgets such as Status, Resource Utilization, Power, and Fan details display no data when a few devices are deleted and re-discovered from Network Director.
Workaround: None available at present. [PR1122181]
- The Client Sessions and Session Trend widgets might not show any data when a Virtual Chassis member is assigned under Location View or Custom Group View.
Workaround: Assign the Virtual Chassis logical device as a whole under Location View or Custom Group View. [PR1012400]

- Running a VM to VM flow analysis might fail or show latency values as 0/0/0 if there are other flows on the VMs being analyzed.

Workaround: None available at present. [PR1062477]

- When a QFabric node device alias is changed, Historical Monitoring data will be lost and port entries might be duplicated.

Workaround: Delete QFabric from Network Director and rediscover the node devices. [PR926912]

- Network Director does not display alarms at the member or node level for a Virtual Chassis or a Virtual Chassis Fabric.

Workaround: Select the Virtual Chassis or the Virtual Chassis Fabric device in Logical View to view the alarms. [PR991298]

- After you upgrade Network Director from Release 2.5 to Release 3.0, you might not be able to add QFX-5200 and QFX5100-24Q switches as leaf devices under Layer 3 Fabrics.

Workaround: None available at present. [PR1235922]

- 100-Gigabit Ethernet ports are shown as 40-Gigabit Ethernet ports in the Convert Ports page unless explicitly set in device.

Workaround: Set the ports with 100-Gigabit transceivers in the device by using the command: `set chassis fpc 0 pic 0 port 8 speed 100G` and commit the configuration. Wait for the device to be in sync. The Convert Ports page now shows the port correctly as a 100-Gigabit Ethernet port. [PR1234853]

- Network Director deletes the configuration for ports for which auto-speed detection is disabled in Port Conversion.

Workaround: None available at present. [PR1228275]

- The Deploy Configuration page lists all devices for Port Conversion.

Workaround: Use the Device Selection page to only those devices for which you want to convert ports. [PR1227932]

- Port Conversion pushes the configuration to incorrect FPCs if the renumbering member ID command is used in the configuration for devices that support VC and VCF configurations.

Workaround: None available at present. [PR1227497]

- Network Director might not validate port groups in Port Conversion for QFX10002 and QFX10008 switches.

Workaround: None available at present. [PR1228276]

- After you upgrade Network Director from Release 2.5 to Release 3.0, incorrect roles are displayed for some of the users.

Workaround: Roles and tasks are not deleted after the upgrade and only additional tasks are added. Delete these additional tasks after the upgrade. [PR1231329]

- Unable to create Layer 3 fabrics as Zero Touch Provisioning (ZTP) is not supported on Centos 7.2.1511 and DHCP 4.2.5.

Workaround: Use the following versions for ZTP support:

- Ubuntu 14.04
- Centos 6.6

[PR1235928]

- VLANs that are not configured with Layer 3 interfaces are mapped to spine devices.

Workaround: None available at present. [PR1237441]

- Device LAG ports configuration is not supported in EVPN-VXLAN.

Workaround: Use the multi-home LAG option to configure device LAG ports. [PR1236498]

- For IP Fabrics you cannot configure network address as start address.

Workaround: Use a valid network IP address in the subnet. [PR1233532]

- Editing a tenant and assigning ports to a new leaf device, results in failed deployment.

Workaround: Create a new IP fabric device and assign ports to the device before you edit a tenant and deploy it. [PR1232167]

- The Auto assigned option is not deleted if you remove a Port profile association that is assigned by auto policy and manually assign the same option.

Workaround: None available at present. [PR1202439]

- After you delete a port association from Port profile, the LLDP does not show which device is connected when you issue the command delete interface interface-name.

Workaround: Assign a Port profile to a port manually or by using quick template, to configure unit 0 on the interface. [PR1223305]

- After adding a cascade port, the satellite cluster is not added to the aggregation devices when the link up event is triggered.

Workaround:

1. Connect the device directly to a cascade port on the aggregation device.
2. Configure the port as a cascade port.
3. Refresh the topology and verify the configuration generated on the device.
4. After the resync fusion inventory job is triggered, check the tree to see whether the cluster is added to the Enterprise Fusion setup.

[PR1228613]

- If you add more than one port to a Port profile that is associated to the extended Port profiles, the deployment fails.

Workaround: After the deployment fails, edit the prompted Port profile and deploy the changes again. [PR1237763]

- The tree view is not correctly displayed when there is more than one cluster with the same name in the tree view.

Workaround:

1. Make sure only ICCP and ICL devices are connected, and refresh the topology.

The link up event is triggered only for redundancy satellite devices, and not for FPC satellite devices.

2. Connect single-home satellite device or a cluster devices to one of the aggregation device in a multi-host setup and refresh the topology.

The link up event generates the configuration for different FPC devices.

[PR1225525]

- Monitoring cannot be disabled for aggregation devices at the group level.

Workaround: None available at present. [PR1213805]

- The configuration for orchestration for ELS devices fails if you select the interface mode as access or if you do not configure an interface mode.

Workaround: Log in to the device and set interface mode as trunk for the interface and then configure orchestration for that interface. [PR1235223]

- The Port Conversion page displays for EX4600 switches even though the port conversion is not supported for these devices.

Workaround: Do not select EX4600 devices for port conversion. [PR1226676]

- Adding leaf to an existing multihome LAG, editing the multihome ae inetface, or deleting an existing leaf from the LAG are not supported in an overlay network.

Workaround: None available at present. [PR1206683]

- After an upgrade to Network Director 3.0, earlier versions of APIs are listed.

Workaround: Right-click on the APIs and select Uninstall to remove the earlier versions. [PR1229453]

- The quick template functionality is not supported in Junos Fusion Enterprise devices.

Workaround: None available at present. [PR1239050]

- In a medium-scale Junos Fusion setup where five Junos Fusion systems each with 100 Satellite Devices are managed, incorrect monitoring data is displayed.

Workaround: In a Junos Fusion setup where 5 Junos Fusion systems each with 100 Satellite Devices are managed, change the number of parallel requests by setting the system property to 5 from default value 25.

To change the parallel requests value:

1. Open a debug (command) prompt by using the Junos Space Settings Menu.
2. Navigate to `/usr/local/jboss/domain/configuration/host.xml`
3. Under `<jvm-options>`, change the option value `<option value="-Dmonitoring.simultaneous.request=5"/>`
4. Restart the jboss process.

```
service jboss restart
```

[PR1239748]

- When large number of devices are discovered in Network Director, some of the device status is shown as Down in Network Director even though their status is shown as UP in Junos Space Management Platform.

Workaround: Delete devices that are incorrectly shown as Down in Network director and re-discover the devices in Network Director. [PR1207914]

- In large-scale environments, some of the devices cannot be monitored after the device discovery.

Workaround: Restart the JBoss server for the monitoring features to work properly in standalone and cluster setups:

To restart the JBoss server in a standalone setup:

1. Stop the watchdog, domain controller, and JBoss services on the standalone node.

```
service jmp-watchdog stop
```

```
service jboss-dc stop
```

```
service jboss stop
```

2. Start the watchdog service.

```
service jmp-watchdog start
```



NOTE: Starting the watchdog service restarts the JBoss and domain controller services as well.

To restart the JBoss server in a cluster setup:

1. Stop the services on the secondary node.

```
service jmp-watchdog stop
```

```
service jboss stop
```

2. Stop the services on the master node (You can find the VIP hosted node at Space > Fabric).

```
service jmp-watchdog
```

```
stop service jboss-dc
```

```
stop service jboss stop
```

3. Start the watchdog service on the master node.

```
service jmp-watchdog start
```

4. Start the watchdog service on the secondary node.

```
service jmp-watchdog start
```

[PR1165010]

- The Port status and the power supply status is not shown in a cluster setup when two satellite devices are configured as member nodes.

Workaround: None available at present. [PR1223602]

- The overlay fabric configuration does not get deleted when you remove an IP fabric from the Selected section of the Edit Overlay Fabric page. However, the overlay fabric configuration gets deleted if the overlay is deleted from the from the Manage Overlay Fabric page.

Workaround: None available at present. [PR1234916]

- ESXi server does not work on ports that have only one VLAN configured. When a tenant overlay fabric is configured such that one of the ports is configured with only one VLAN, native VLAN ID is set to the ID of the only VLAN configured on the interface. This allows Bare Metal Servers (BMS) to use untagged packets. For an ESXi server to work on such ports, the native VLAN ID needs to be removed.

Workaround: Deploy a template by using the command `delete interface native-vlan-id` for those interfaces where one VLAN is configured and tagged packets are sent. ESXi server uses tagged packets by default. [PR1234899]

- Duplicate Port profiles are shown in Network Director after you upgrade Network Director from:
 - Release 2.5R1 to Release 3.0R1 or 3.0R2
 - Release 2.5R2 to Release 3.0R1 or 3.0R2

Workaround: Delete all the unassigned profiles that are generated as duplicate Port profiles. You can identify duplicate Port profiles from the profile name. A duplicate Port profile name is suffixed with a number. For example, iSCSI_918. [PR1246846]

- High CPU utilization is observed in the EX2200, EX2300, EX3400, or EX3300 devices when these devices are managed and monitored in Network Director.

Workaround: Increase the poll interval from default 10 mins to 40 or 50 mins for the categories PortTrafficMonitorCollector and EquipmentMonitorDeviceStatusCollector under monitor settings.

To increase the poll interval:

1. Navigate to **Preferences > Monitoring > Monitoring Settings**.

The Preferences page displays the monitoring settings.

2. In the **Poll Interval (in mins)** field, enter the poll interval for the categories PortTrafficMonitorCollector and EquipmentMonitorDeviceStatusCollector.
3. Click **OK**.



NOTE: The poll interval for both the categories should be the same.

If increasing poll interval does not reduce the CPU usage, disable monitoring for affected devices.

To disable monitoring for the devices:

1. Navigate to **Preferences > Monitoring > Device Settings**.

The Preferences page displays Enable/Disable Collection for devices in a tabular format.

2. From the table, select the check box that corresponds to the device for which you want to disable the monitoring.
3. Click **Disable**.
4. Click **OK**.

[PR1285504]

- In a Junos Fusion Data Center setup, if the alias name of the satellite device does not match on both the aggregation devices, Network Director does not show the monitoring data for the satellite devices.

Workaround: Configure the same alias name for the satellite device on both the aggregation devices. [PR1293816]

- After the IP Fabric provisioning is successfully completed, auto discovery of IP fabric is not getting triggered in Network Director. This is observed when the eth3 interface IP address is changed on Junos Space sever after Junos Space installation.

Workaround: Modify the eth3 IP address in the .conf files that are pushed to the TFTP server when provisioning the IP Fabric. This ensures that new eth3 interface IP address is used by Network Director while discovering the IP Fabric. [PR1293526]

- In Network Director Wired Device Common Settings, you cannot disable the DHCP relay on a device.

Workaround: To disable the DHCP relay on a device, access the device by using the CLI and remove the DHCP relay config stanza from the device. [PR1290375]

- In Network Director Wired Device Common Settings, you cannot delete the profile login settings relay on a device.

Workaround: To delete the profile login from a device, access the device by using the CLI and remove the Profile Login configuration stanza from the device. [PR1291978]

- When the Connection Association Key and Confirm Connection Association Key are edited in a MACsec profile, the MACsec profile does not show the state as Pending Deployment.

Workaround: Edit some other attribute in the MACsec profile along with the Connection Association Key and Confirm Connection Association Key for the MACsec profile to show the state as Pending Deployment. [PR1295679]

- After upgrading Network Director from the following upgrade paths, Network Director is not shown in the list of installed applications:
 - 3.0R1 ->3.2R1
 - 3.0R2->3.2R1
 - 3.1R1->3.2R1
 - 3.1R2->3.2R1

Workaround: Restart the Jboss server.

To restart the JBoss server in a standalone setup:

1. Stop the watchdog, domain controller, and JBoss services on the standalone node.

```
service jmp-watchdog stop
```

```
service jboss-dc stop
```

```
service jboss stop
```

2. Start the watchdog service.

```
service jmp-watchdog start
```



NOTE: Starting the watchdog service restarts the JBoss and domain controller services as well.

To restart the JBoss server in a cluster setup:

1. Stop the services on the secondary node.

```
service jmp-watchdog stop
```

```
service jboss stop
```

2. Stop the services on the master node (You can find the VIP hosted node at Space > Fabric).

```
service jmp-watchdog
```

```
stop service jboss-dc
```

```
stop service jboss stop
```

3. Start the watchdog service on the master node.

```
service jmp-watchdog start
```

4. Start the watchdog service on the secondary node.

```
service jmp-watchdog start
```



NOTE: Starting the watchdog service restarts the JBoss and domain controller services as well. JBoss server takes up to 20 minutes to start.

[PR1349070]

Resolved Issues

There are no resolved issues in Network Director Release 3.3R1.

Documentation Updates

This section lists the errata and changes in Network Director Release 3.3R1 documentation.

Network Director Release 3.3R1 online Help has the following documentation errata:

- Context-sensitive help is not available for the following pages of Monitor mode.
 - Tasks > Show PoE Information Table
 - Tasks > Show Routing Table

However, you can access the documentation for these pages from the [Network Director 3.3 documentation site](#) or by clicking the online **Help** button in the Network Director home page.

Third-Party Integration

- **Juniper Networks Data Center Switching Management Pack for vROps**—VMware vRealize Operations (vROps) is a component of VMware's vRealize suite of products. vROps provides an integrated, single pane of glass view into the performance, capacity, and configuration management capabilities of VMware vSphere, physical and cloud environments.

Juniper Networks Data Center Switching Management Pack for vROps is a plugin from Juniper Networks that you can install and integrate with vROps. Once installed, the management pack obtains all the necessary monitoring data from Juniper Networks devices and displays the data in vROps.

- **Juniper Networks plugin for VMware vCenter**—You can discover and manage VMware vCenter servers by using Network Director. Network Director enables you to visualize and perform certain management tasks on the vCenter servers. If you primarily use the VMware vSphere to manage your virtual network and want to view details about the Juniper Networks devices that are connected to your virtual network, you can do so by installing the Juniper Networks plugin for VMware vCenter. After you install and configure this plugin on the vCenter server, you can start viewing data about the connected Juniper Networks devices by using the following widgets:
 - **Physical Networking widget**—To open this widget, select a **Host** in the vSphere user interface and select **Summary**. This widget displays the virtual NIC that the host connects to, the physical switch and the port number that the virtual switch uses to connect to the physical network, and the VLAN that is configured on the physical switch port.
 - **vMotion History widget**—To open this widget, select a virtual machine in the vSphere user interface and select **Summary**. This widget displays the vMotion history of the selected virtual machine along with details of the Juniper Networks switches that were involved in the vMotion.

You can download the Juniper Networks Data Center Switching Management Pack for vROps and the Juniper Networks plugin for VMware vCenter from the [Download Software](#) page. See the [Juniper Networks Data Center Switching Management Pack for vROps documentation](#) and README file that is included in the Juniper Networks plugin for VMware vCenter zip file for detailed steps on installing the plugin.

Finding More Information

For the latest, most complete information about known and resolved issues with Junos Space Network Management Platform and Junos Space Management Applications, see the Juniper Networks Problem Report Search application at: <http://prsearch.juniper.net>.

Juniper Networks Feature Explorer is a Web-based application that helps you to explore and compare Junos Space Network Management Platform and Junos Space Management

Applications feature information to find the correct software release and hardware platform for your network. Find Feature Explorer at:

<http://pathfinder.juniper.net/feature-explorer/>.


Juniper Networks Content Explorer is a Web-based application that helps you explore Juniper Networks technical documentation by product, task, and software release, and download documentation in PDF format. Find Content Explorer at:

<http://www.juniper.net/techpubs/content-applications/content-explorer/>.

Documentation Feedback

We encourage you to provide feedback, comments, and suggestions so that we can improve the documentation. You can provide feedback by using either of the following methods:

- Online feedback system—Click TechLibrary Feedback, on the lower right of any page on the [Juniper Networks TechLibrary](#) site, and do one of the following:

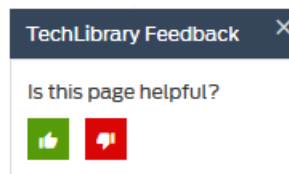

- Click the thumbs-up icon if the information on the page was helpful to you.
- Click the thumbs-down icon if the information on the page was not helpful to you or if you have suggestions for improvement, and use the pop-up form to provide feedback.
- E-mail—Send your comments to techpubs-comments@juniper.net. Include the document or topic name, URL or page number, and software version (if applicable).

Requesting Technical Support

Technical product support is available through the Juniper Networks Technical Assistance Center (JTAC). If you are a customer with an active J-Care or Partner Support Service support contract, or are covered under warranty, and need post-sales technical support, you can access our tools and resources online or open a case with JTAC.

- JTAC policies—For a complete understanding of our JTAC procedures and policies, review the *JTAC User Guide* located at <https://www.juniper.net/us/en/local/pdf/resource-guides/7100059-en.pdf>.
- Product warranties—For product warranty information, visit <http://www.juniper.net/support/warranty/>.
- JTAC hours of operation—The JTAC centers have resources available 24 hours a day, 7 days a week, 365 days a year.

Self-Help Online Tools and Resources

For quick and easy problem resolution, Juniper Networks has designed an online self-service portal called the Customer Support Center (CSC) that provides you with the following features:

- Find CSC offerings: <https://www.juniper.net/customers/support/>
- Search for known bugs: <https://prsearch.juniper.net/>
- Find product documentation: <https://www.juniper.net/documentation/>
- Find solutions and answer questions using our Knowledge Base: <https://kb.juniper.net/>
- Download the latest versions of software and review release notes: <https://www.juniper.net/customers/csc/software/>
- Search technical bulletins for relevant hardware and software notifications: <https://kb.juniper.net/InfoCenter/>
- Join and participate in the Juniper Networks Community Forum: <https://www.juniper.net/company/communities/>
- Create a service request online: <https://myjuniper.juniper.net>

To verify service entitlement by product serial number, use our Serial Number Entitlement (SNE) Tool: <https://entitlementsearch.juniper.net/entitlementsearch/>

Creating a Service Request with JTAC

You can create a service request with JTAC on the Web or by telephone.

- Visit <https://myjuniper.juniper.net>.
- Call 1-888-314-JTAC (1-888-314-5822 toll-free in the USA, Canada, and Mexico).

For international or direct-dial options in countries without toll-free numbers, see <https://support.juniper.net/support/requesting-support/>.

Revision History

27 June, 2018—Revision 1, Junos Space Network Director Release 3.3R1.

Copyright © 2019 Juniper Networks, Inc. All rights reserved.

Juniper Networks, the Juniper Networks logo, Juniper, and Junos are registered trademarks of Juniper Networks, Inc. and/or its affiliates in the United States and other countries. All other trademarks may be property of their respective owners.

Juniper Networks assumes no responsibility for any inaccuracies in this document. Juniper Networks reserves the right to change, modify, transfer, or otherwise revise this publication without notice.